


Размеры Ш-образных ферритовых сердечников.

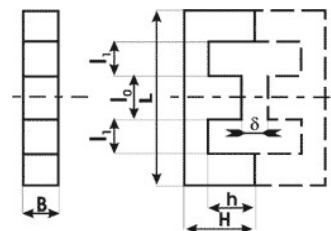

Типоразмер	L (мм)	H (мм)	B (мм)		l ₀ (мм)	l ₁ (мм)	h (мм)
Ш 2,5x2,5	10,0 ±0,35	5,0 ±0,20	2,5 -0,30		2,5 -0,30	2,0 +0,30	3,2 +0,40
Ш 2,8x6	12,9 ±0,30	6,0 ±0,20	6	0,2 -0,3	2,8 ±0,10	3,9 +0,20	4,7 ±0,20
Ш 3x3	12,0 ±0,50	6,0 ±0,20	3,0 -0,30		3,0 -0,30	2,5 +0,30	4,0 +0,40
Ш 4x4	16,0 ±0,50	8,0 ±0,25	4,0 -0,50		4,0 -0,40	3,2 +0,50	5,2 +0,40
Ш 4,1x4,1	14,7 ±0,35	7,7 ±0,20	4,1	0,2 -0,3	4,1 ±0,20	3,4 ±0,20	5,3 ±0,20
Ш 4x8	16,0 ±0,50	8,0 +0,25	8,0 -0,50		4,0 -0,40	3,2 +0,50	5,2 +0,40
Ш 5x5	20,0 ±0,60	10,0 ±0,25	5,0 -0,50		5,0 -0,40	4,0 +0,50	6,5 +0,50
Ш 6x6	24,0 ±0,60	12,0 ±0,35	6,0 -0,50		6,0 -0,40	5,0 +0,50	8,0 +0,50
Ш 7x7	30,0 ±0,80	15,0 ±0,35	7,0 -0,70		7,0 -0,50	6,0 +0,50	9,5 +0,50
Ш 7,5x7,5	25,0 ±0,80	12,8 ±0,50	7,5 -0,50		7,5 -0,50	17,5 +0,80	8,7 +0,50
Ш 8x8	32,0 ±1,10	16,0 ±0,35	8,0 -0,70		8,0 -0,50	7,5 +0,70	11,5 +0,70
Ш 10x10	36,0 ±1,10	18,0 ±0,45	10,0 -0,70		10,0 -0,50	8,0 +0,70	13,0 +0,70
Ш 12x15	42,0 ±1,30	21,0 ±0,45	15,0 -1,00		12,0 -0,70	9,0 +0,70	15,0 +0,70
Ш 12x20	42,0 ±1,30	21,0 ±0,45	20,0 -1,20		12,0 -0,70	9,0 +0,70	15,0 +0,70
Ш 16x20	54,0 ±1,50	27,0 ±0,55	20,0 -1,20		16,0 -0,70	11,0 +1,00	19,0 +0,90
Ш 20x28	65,0 ±1,50	32,5 ±0,70	28,0 -1,60		20,0 -0,90	12,0 +1,00	22,0 +0,90